



Europäisches **Patentamt**

European **Patent Office** des brevets

Bescheinigung

Certificate

Attestation

Die angehefteten Unterlagen stimmen mit der ursprünglich eingereichten Fassung der auf dem nächsten Blatt bezeichneten europäischen Patentanmeldung überein.

The attached documents are exact copies of the European patent application described on the following page, as originally filed.

Les documents fixés à cette attestation sont conformes à la version initialement déposée de la demande de brevet européen spécifiée à la page suivante.

Patentanmeldung Nr.

Patent application No. Demande de brevet nº

03076489.8 ✓

BEST AVAILABLE COPY

PRIORIT DOCUMENT

SUBMITTED OR TRANSMITTED IN COMPLIANCE WITH RULE 17.1(a) OR (b) Der Präsident des Europäischen Patentamts;

For the President of the European Patent Office

Le Président de l'Office européen des brevets p.o.

R C van Dijk



Anmeldung Nr: . . Application no.:

03076489.8

Demande no:

Anmeldetag:

Date of filing: 16.05.03

Date de dépôt:

Anmelder/Applicant(s)/Demandeur(s):

Koninklijke Philips Electronics N.V. Groenewoudseweg 1 5621 BA Eindhoven PAYS-BAS

Bezeichnung der Erfindung/Title of the invention/Titre de l'invention: (Falls die Bezeichnung der Erfindung nicht angegeben ist, siehe Beschreibung. If no title is shown please refer to the description. Si aucun titre n'est indiqué se referer à la description.)

Lamp with a mica cementing plate

In Anspruch genommene Prioriät(en) / Priority(ies) claimed /Priorité(s) revendiquée(s)
Staat/Tag/Aktenzeichen/State/Date/File no./Pays/Date/Numéro de dépôt:

Internationale Patentklassifikation/International Patent Classification/Classification internationale des brevets:

H01J61/00

Am Anmeldetag benannte Vertragstaaten/Contracting states designated at date of filing/Etats contractants désignées lors du dépôt:

AT BE BG CH CY CZ DE DK EE ES FI FR GB GR HU IE IT LU MC NL PT RO SE SI SK TR LI

1

16.05.2003

Lamp with a mica cementing plate

a) What was known on the subject, and from what source?

Within the construction of the CDM-Aluline 35W lamp, a metal cementing plate is used.

The cementing plate is positioned on the pinch of the quartz CDM-TC 35W capsule. A quartz sleeve is mounted on top of the capsule with the cementing plate. (see picture 1 and 2). This cementing plate prevents the ceramic cement from passing through. (see picture 3).



10 Picture I




Picture 2

Picture 3

5 b) What are the drawbacks of this?

Cracking of the quartz sleeve was observed during lifetime experiments (picture 4). This cracking is caused by the large difference in thermal expansion between the metal cementing plate and the quartz sleeve.

During heating up the metal plate is pressing on the quartz sleeve. This causes a build up of too high stresses in the glass wall that finally leads to cracking of the quartz.

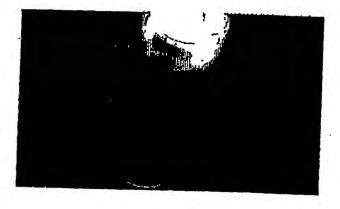

15 Picture 4

c) What is the invention?

Replacing the metal cementing plate by a Mica plate. Mica is a material that is softer than metal (see picture 5). Because of this no too high stresses can be build up in the glass wall of

PHNL030612BPQ


NR.525 P.9/13 009 16.05.2003 13:52:55

3

16.05.2003

the quartz sleeve. Experiments have shown that the Mica plate can withstand the high lamp temperatures up to 400 C. Also an advantage is the fact that the cement shows no adhesion on the Mica, which is an advantage in avoiding too high stresses as a consequence of differences in thermal expansion between the cement and the sleeve.

5

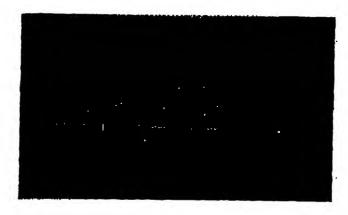


Picture 5

10


Mica cementing plates with the desired complex shape are shown in picture 6. An embodiment of an outer bulb connected to a sleeve according to the invention is shown in picture 7.

15

16.05.2003

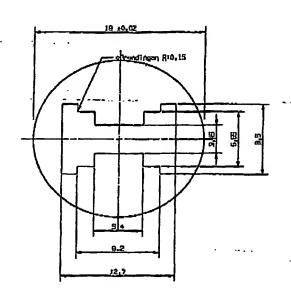



Picture 6

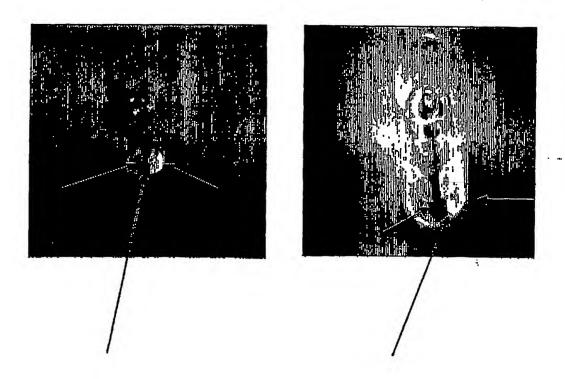

5

16.05.2003

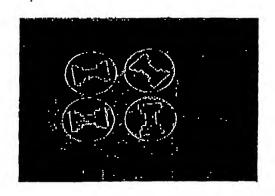

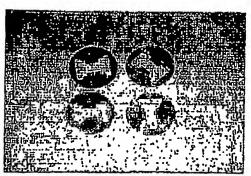

Picture 7

б

16.05.2003

CLAIMS:

5

- A lamp provided with an outer bulb in which a light source is arranged, which outer bulb has an end provided with a seal through which an electric conductor extends towards the exterior of the outer bulb, which outer bulb is at least partly surrounded by a sleeve, which sleeve extends over the region of the seal to an external lamp cap, wherein the sleeve encloses a mica cementing plate forming a separation of the region of the seal surrounded by the sleeve in a first part which extends to the lamp cap and is filled with cement and a second part comprising the outer bulb.
- 2. A lamp according to claim 1 wherein the light source is a high-pressure discharge vessel.
 - 3. A lamp according to claim 1 or 2 wherein the light source is a metal halide source.

16.MEI.2003 13:51

PHILIPS CIP NL +31 40 2743489

NR.525 P.13/13 013 16.05.2003 13:54:00

7

16.05.2003

ABSTRACT:

PHNL030612EPQ

The invention is related to a lamp provided with an outer bulb in which a light source is arranged, which outer bulb has an end provided with a seal through which an electric conductor extends towards the exterior of the outer bulb, which outer bulb is at least partly surrounded by a sleeve, which sleeve extends over the region of the seal to an external lamp cap, wherein the sleeve encloses a mica cementing plate forming a separation of the region of the seal surrounded by the sleeve in a first part which extends to the lamp cap and is filled with cement and a second part comprising the outer bulb.

Fig: Picture 7

5

PCT/IB2004/050642

This Page is inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

BLACK BORDERS
IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
FADED TEXT OR DRAWING
BLURED OR ILLEGIBLE TEXT OR DRAWING
SKEWED/SLANTED IMAGES
□ COLORED OR BLACK AND WHITE PHOTOGRAPHS
☐ GRAY SCALE DOCUMENTS
☐ LINES OR MARKS ON ORIGINAL DOCUMENT
☐ REPERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY
OTHER:

IMAGES ARE BEST AVAILABLE COPY.
As rescanning documents will not correct images problems checked, please do not report the problems to the IFW Image Problem Mailbox